

# SERVICE BULLETIN

NO. 215

DATE: 9/23/03



180 Kehoe Boulevard • P.O. Box 8770 • Carol Stream, IL • USA 60188

PH: 630.784.1000 • TF 877-392-7854 • FAX: 630.784.1655 [www.ajantunes.com](http://www.ajantunes.com)

---

**TO: ALL McDONALD'S SERVICE AGENTS**

**SUBJECT: BUN LANDING AREA KIT, P/N 7000397, FOR VCT-200 & VCT-250 TOASTERS**

With the recent McDonald's approval of our Bun Buffer Landing Zone (BBLZ), more questions may arise regarding the temperature of the Rapid Toaster's Bun Landing Area.

**Before installing the BBLZ, there are two things the restaurant has to check:**

- 1. The Bun Landing Area needs to be FLAT.** If it is not flat the BBLZ will not come into full contact with the Bun Landing Area causing too low of temperature for holding warm buns.
- 2. Measure the temperature of the Bun Landing Area. This needs to be done in the following manner:**

**Allow the Toaster to warm up for 30 minutes.**

**Measure the temperature in the center of the Bun Landing Area directly in front of the Bun Chute, with a calibrated pyrometer.** The minimum acceptable temperature is 130 degrees F.

If the Bun Landing Area is not flat, or if the Bun Landing Area's temperature cannot be reached, the Bun Landing Area will need to be replaced. The part number of the Bun Landing Area kit is #7000397, list price is \$120.10.